

Extreme Shock Battery End Cap for G Series 'S' Style Lighted Nock Installation Manual

1) Installation procedure:

- Remove the plastic nock that comes with the arrow.
- Remove broad head/field tip.
Note: it is due to back pressure can cause glue to not set.
- Screw the aluminum battery end cap onto the nylon screw. (Fig 1)
- Place the O-ring into the groove of the battery end cap. (Fig 2)
Note: If you decide to use gel type super glue, please practice inserting the end cap first before applying glue inside the arrow shaft to ensure that you can insert the end cap within a few seconds.
- Apply a bead of glue to the inside surface of the shaft. (Recommended glue types: Fast Fletch™, Coat tuff™, AAE Fastset Gel™, any 5 minutes epoxy, or slow set epoxy; if you need more time to work.)
- While the glue is still wet, insert the battery end cap, with pointed side first into the arrow shaft. The O-ring ensures that most of the glue is pushed to the back behind the battery end cap.
- Push the nylon screw until the screw head is flush with the flush arrow shaft. (Fig 3)
- Wait till glue dried.
- Try to tighten the nylon screw from the shaft. (Fig 4) If the end cap is still loose, repeat step (e) thru (h) as above.
- Follow the rest of the installation manual that comes with your Firenock/Lightning Nock G 'S' style to complete the installation of your lighted nock.

Schematic installation procedures for Extreme Shock Battery End Cap for G Series 'S' Style Lighted Nock

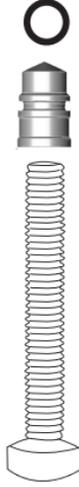


Fig 1

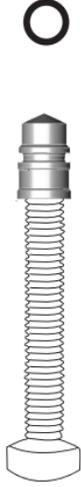


Fig 2

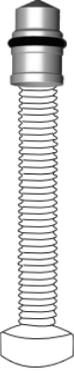


Fig 3



Fig 4